

# Integrity Max

## Initial Start Up Instructions

(Actual hardware may vary from images depicted in this guide)



1.




Plug unit into power outlet

2.




Plug user equipment into power outlets on unit back panel

3.

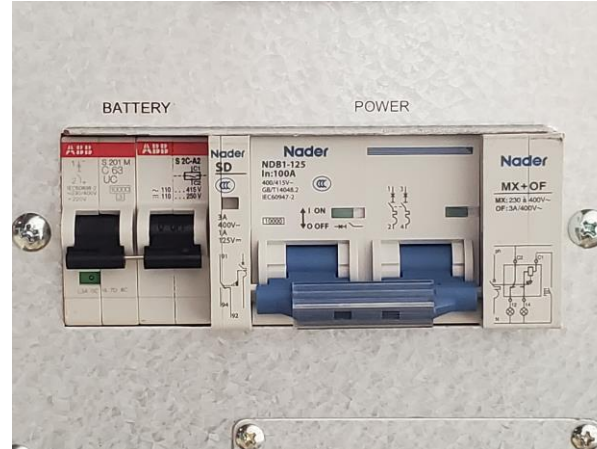

Turn on Battery and Power circuit breakers on back of unit

4.

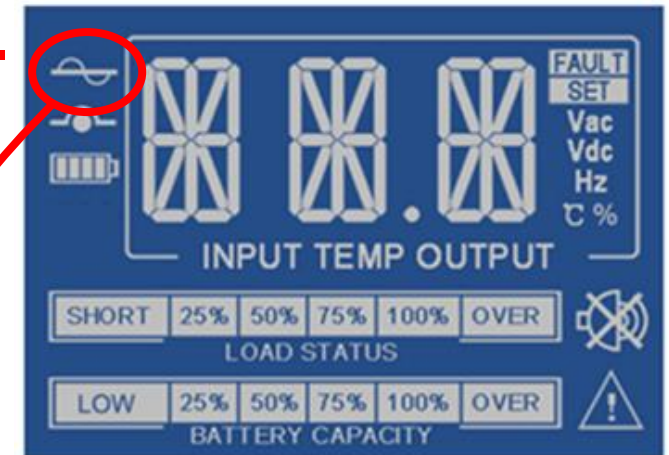

Wait one minute, then verify the sine wave symbol is present in the top left corner of the display (End Of Procedure)